



2733 Gust Road
Verona, WI 53593
www.srbassett.com
www.facebook.com/bassettinc

PH: 608-848-6152
FAX: 608-848-3388

March 26, 2021

Deborah J Hatfeild
119 S Main Street
Cottage Grove, WI 53527

This is an assessment of the trees located within 30ft of the current road on Lacy Road between Fitchrona Road and South Seminole Highway, Fitchburg WI. I surveyed the south side of Lacy road from west to east and then back on the north side from east to west. South side tree numbers are 4-90 and north side tree numbers are 91-143. I documented tree diameter, approximate distance from the road, condition assessment with no leaves, and any obstructions or other notes that would impact the health of the trees.

Listed understory brush areas consist mostly of staghorn sumac, honeysuckle, buckthorn, prickly ash, boxelder, and some ash tree sprouts. These species could be impacted by construction but they will bounce back quickly or reproduce post damage and thrive. These areas listed on the maps attached are highlighted in red.

Most of the desirable species noted are bur oak and hackberry. The bur oaks along the north and south side of the road are mostly in fair condition. There are some white pines, walnut, butternut, and hickory that are listed as well all in good condition.

On the north side of the road between the Rock Ridge subdivision going east to Commerce Park Drive there are many trees and underbrush that are uphill from the road. If the slope is kept similar with no additional excavation, then the plants in this area will be minimally impacted.

Overall, it is my option that any tree or woody understory within 30ft of the existing road edge will be negatively impacted by any kind of construction. It appears that most of the work will consist of widening the road 10-20ft depending on the location. Trees and woody understory within 20ft will need to be removed and any desirable trees within 30ft will be impacted by construction.

Best,


Theresa Williams
Tree Care Manager for Steven R. Bassett Inc.
ISA Certified Arborist WI-0722A

theresa@srbassett.com


Office: 608-848-6152

Cell: 608-220-0801


Full Lacy Road Project

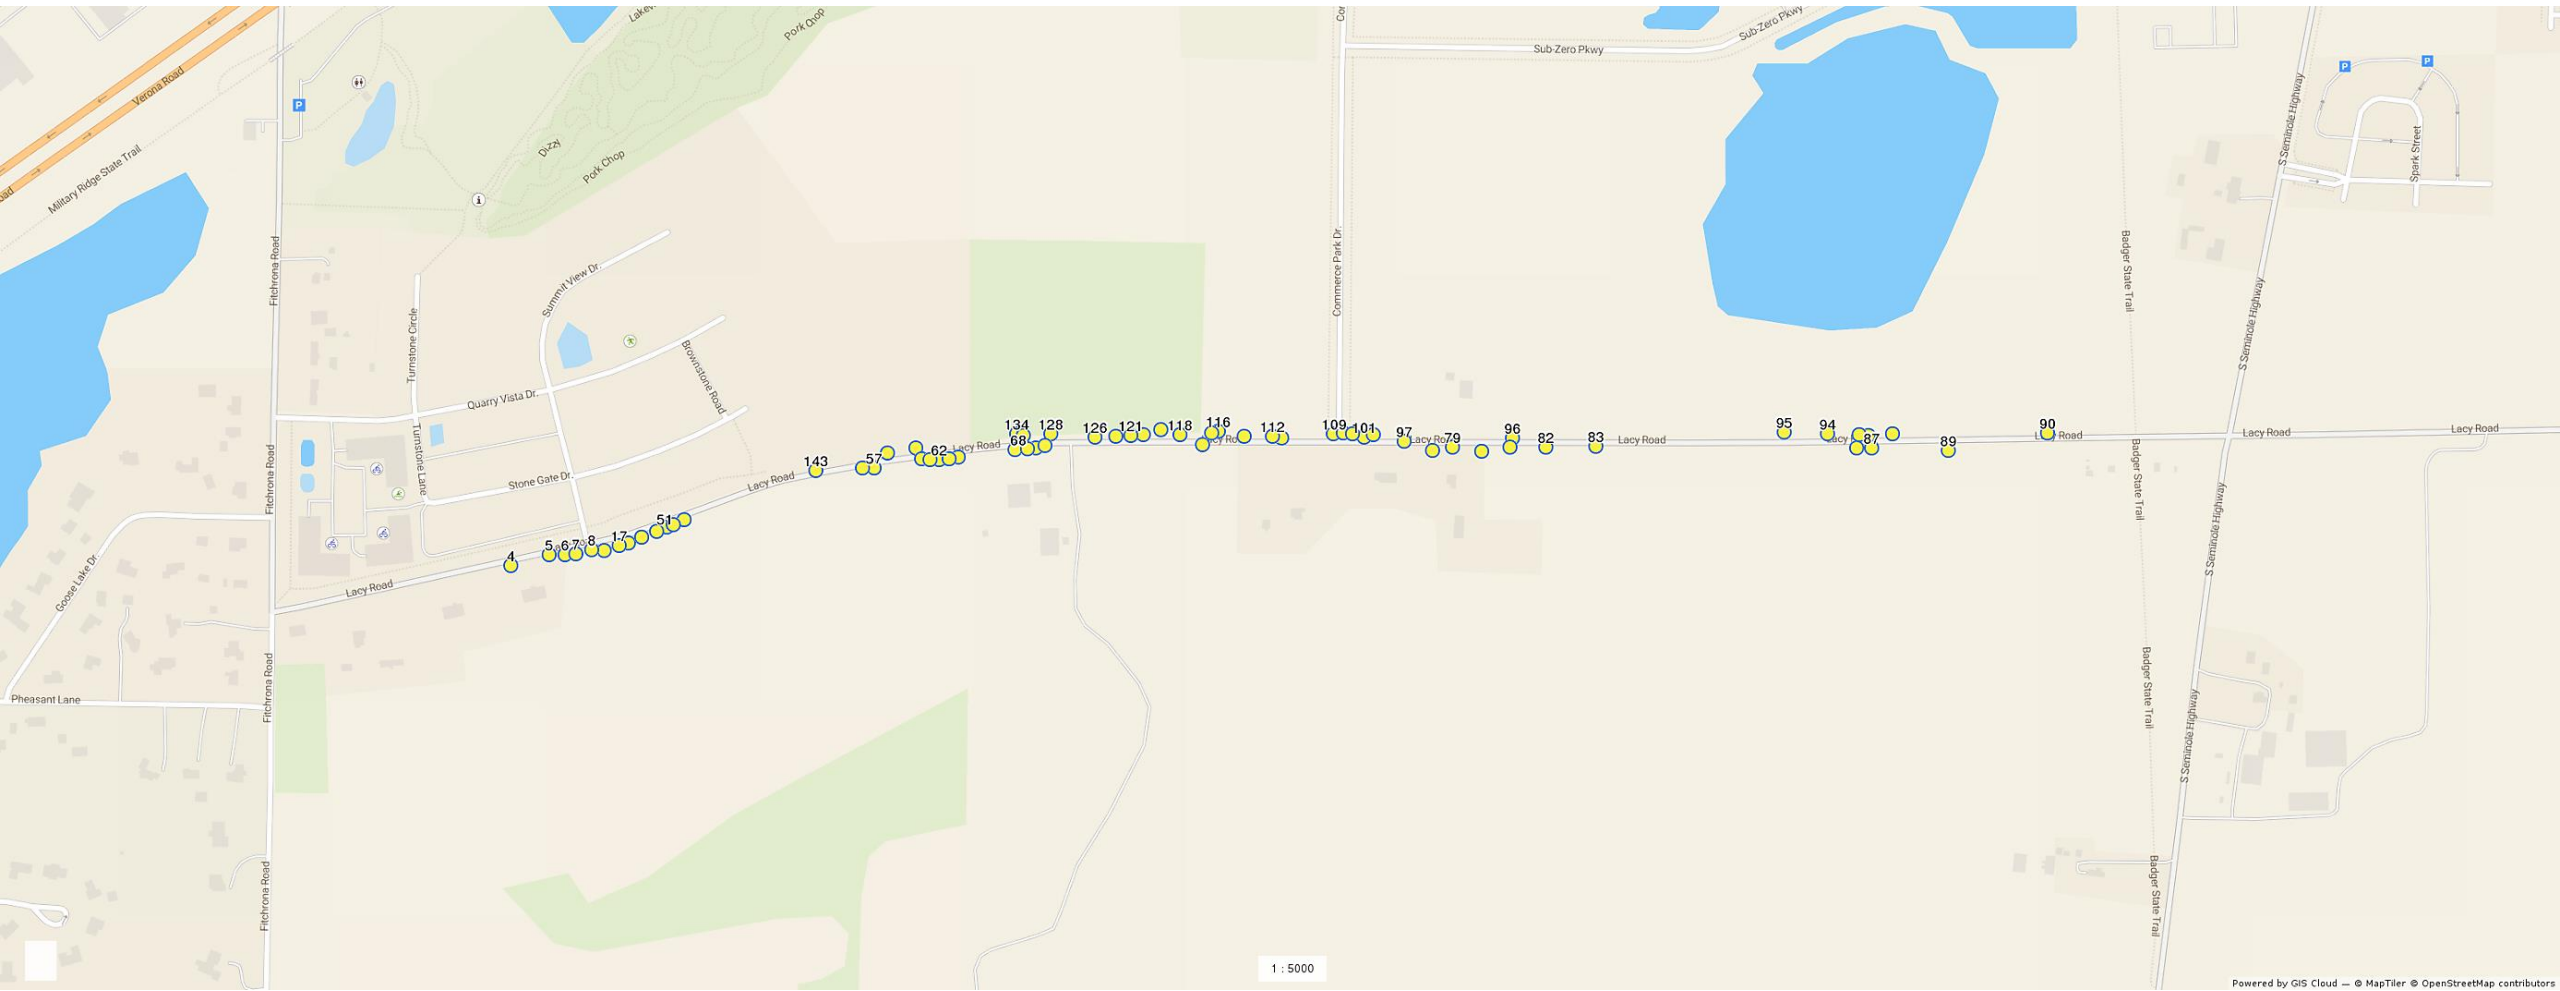


Map 1 West to East

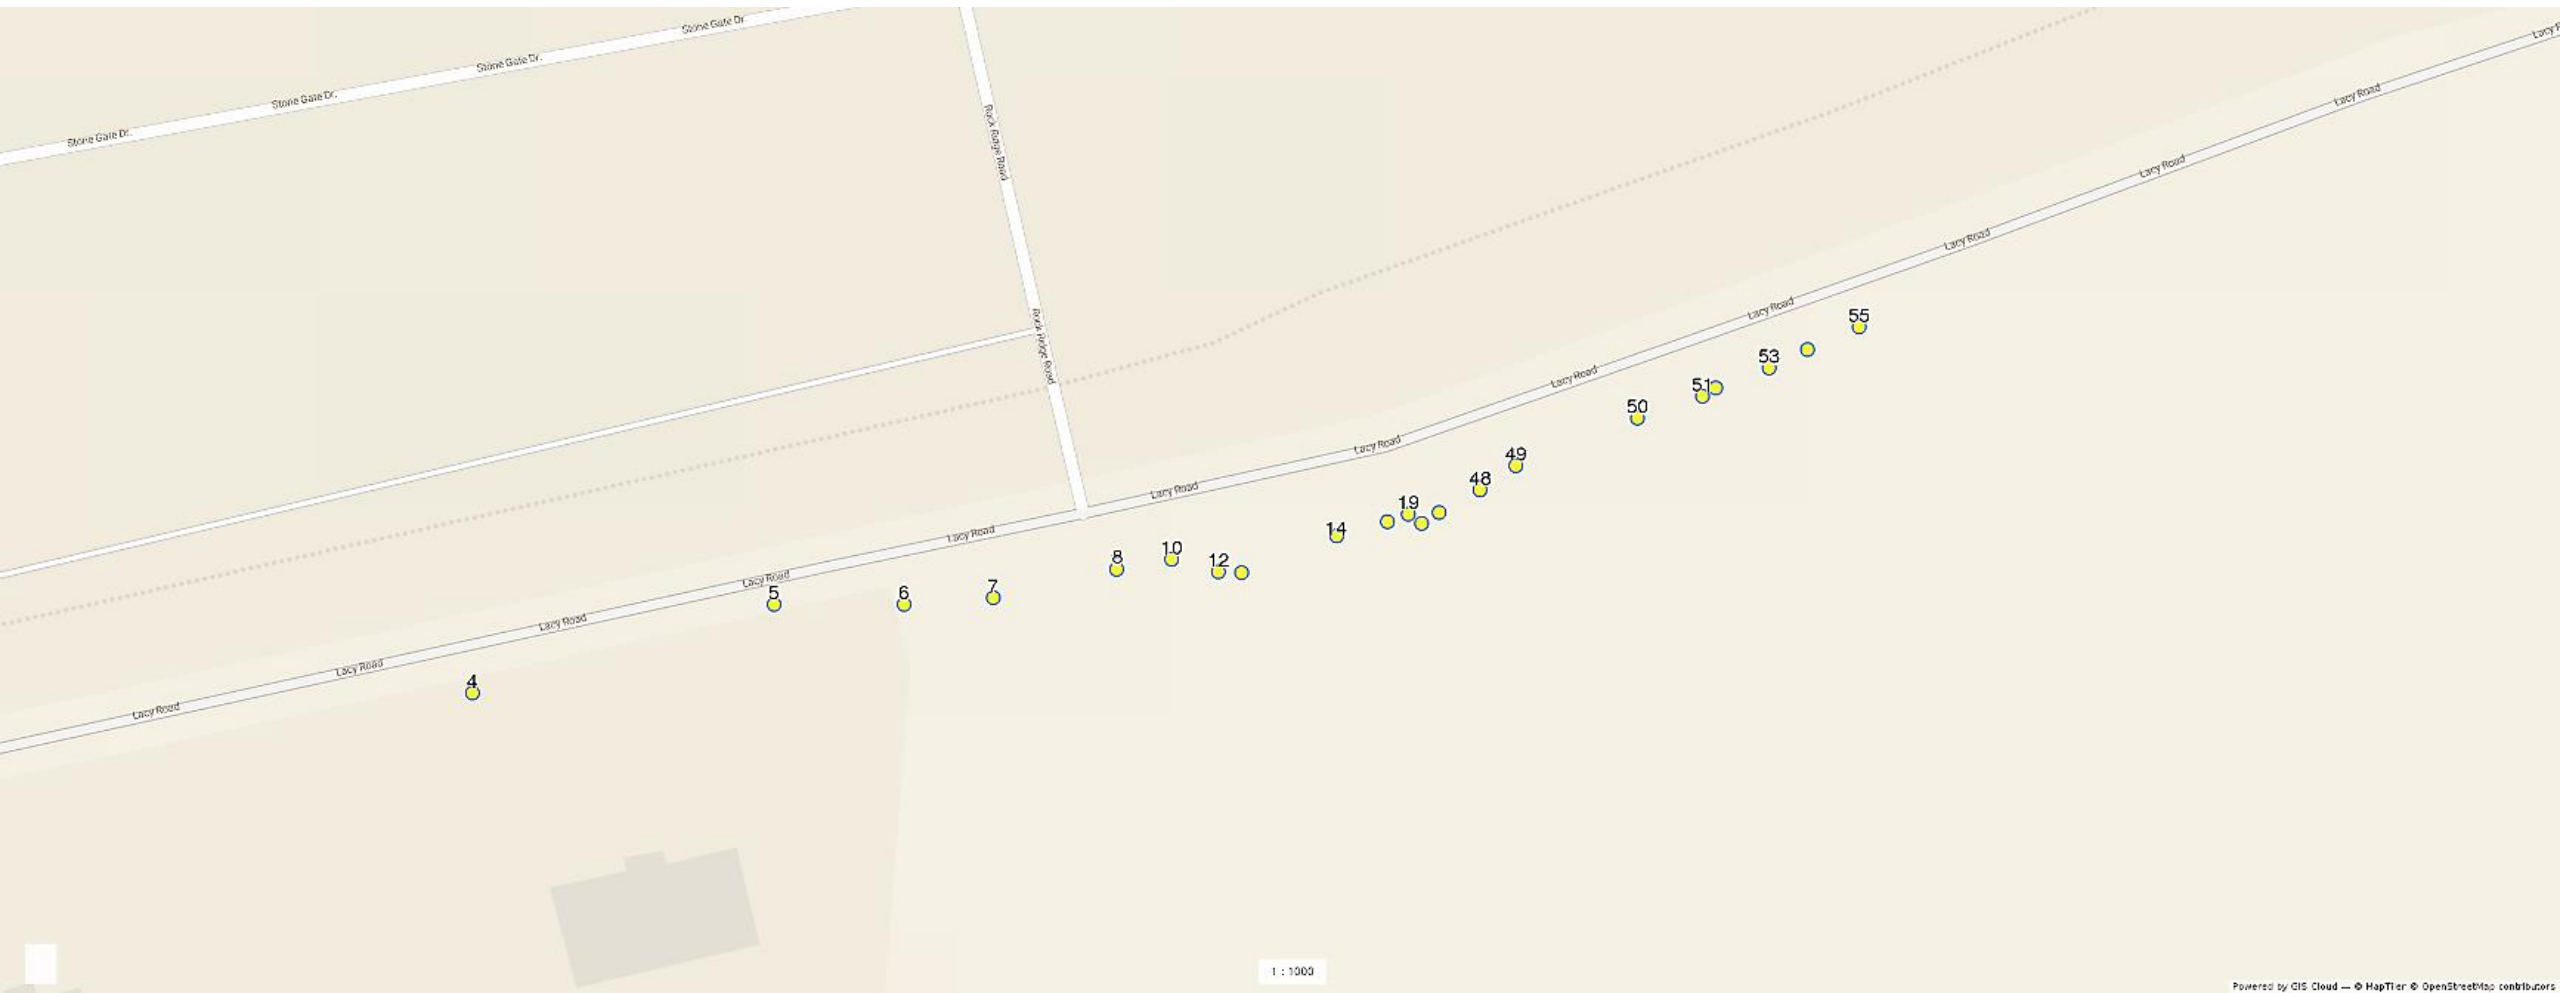

Map 2 West to East

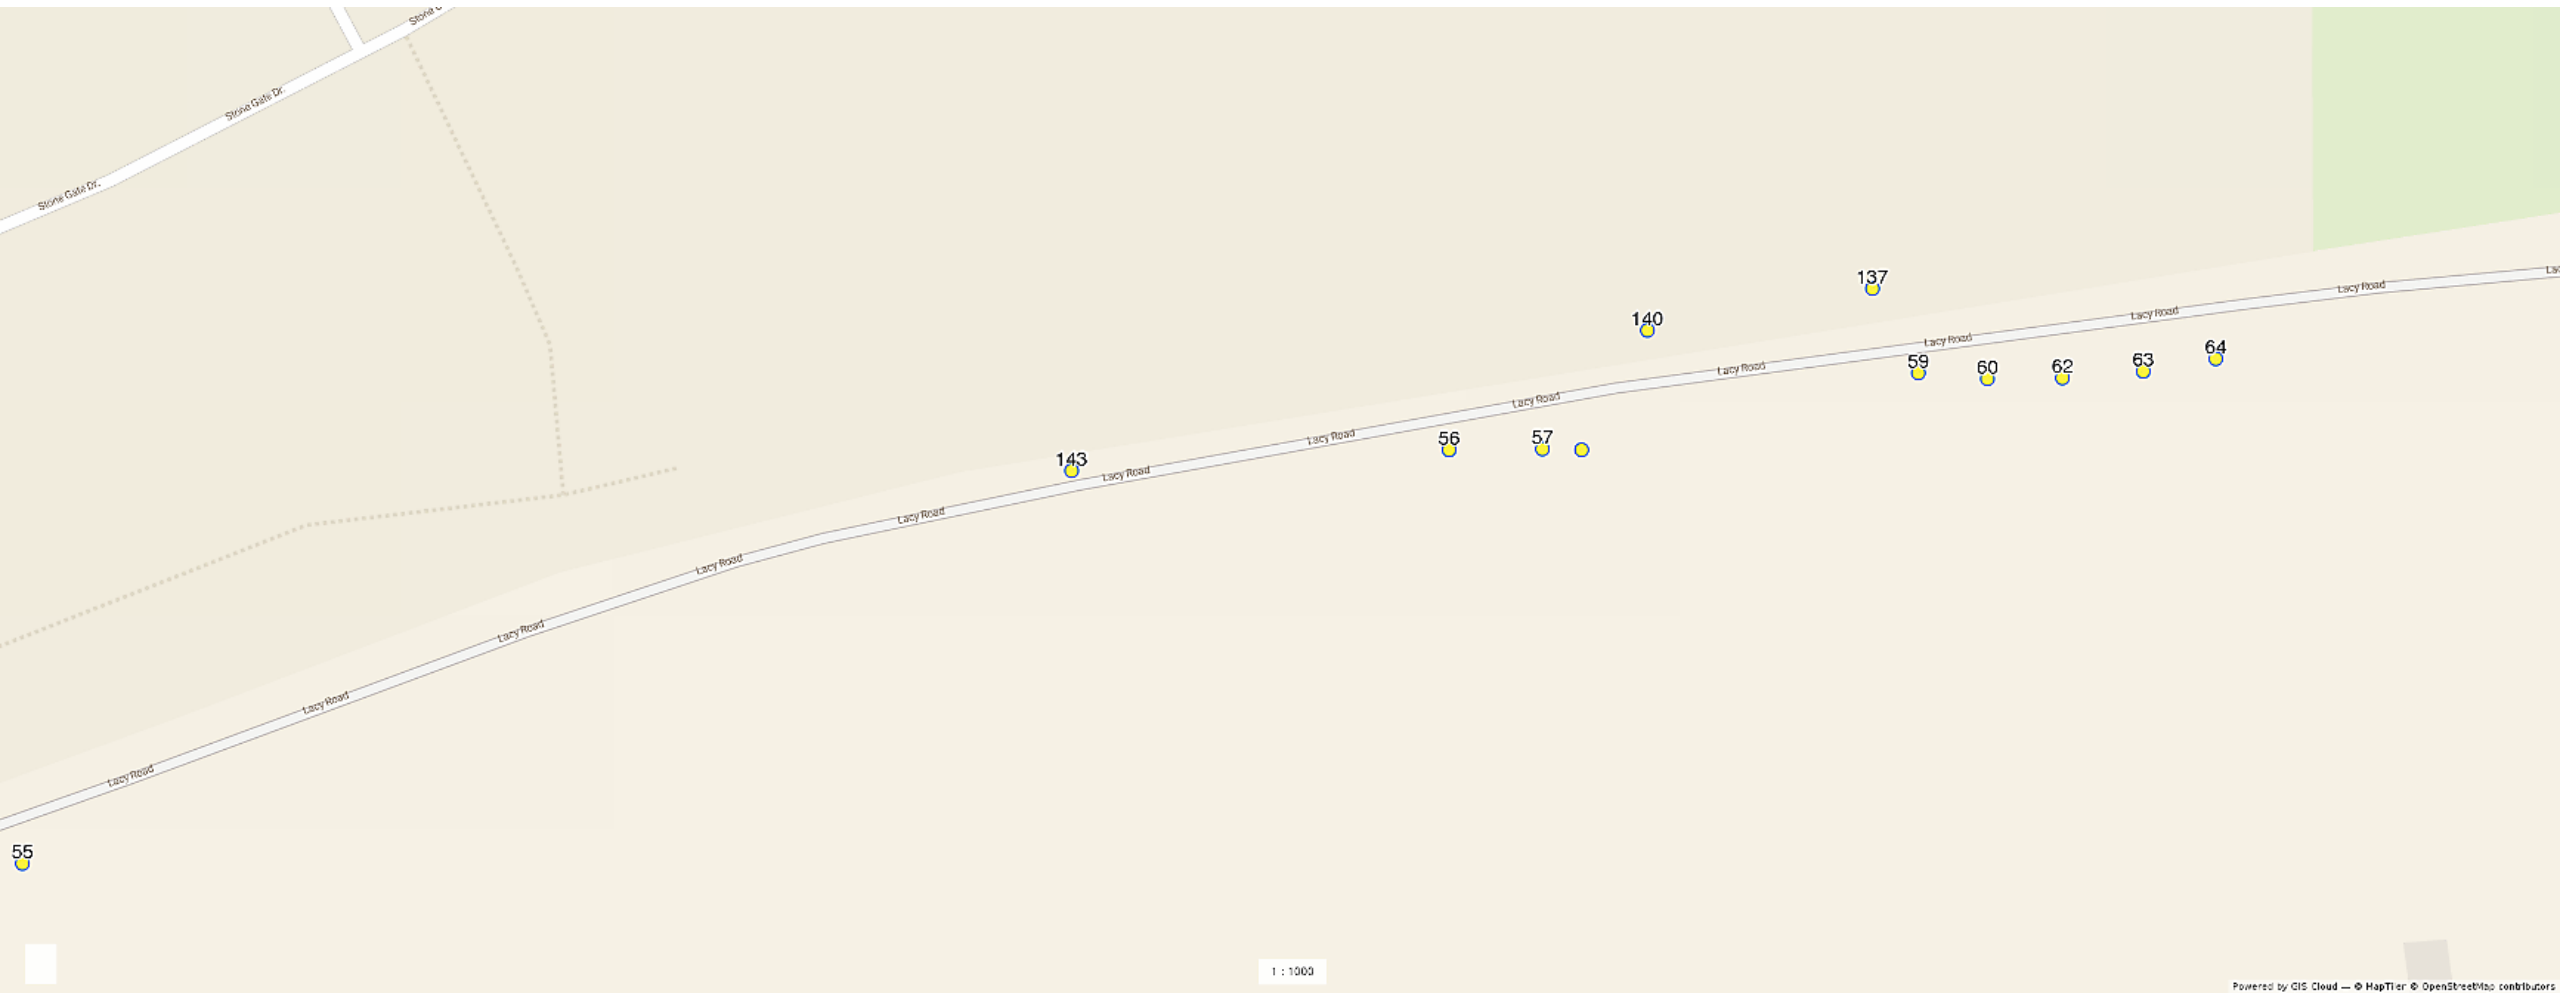

Map 3 West to East

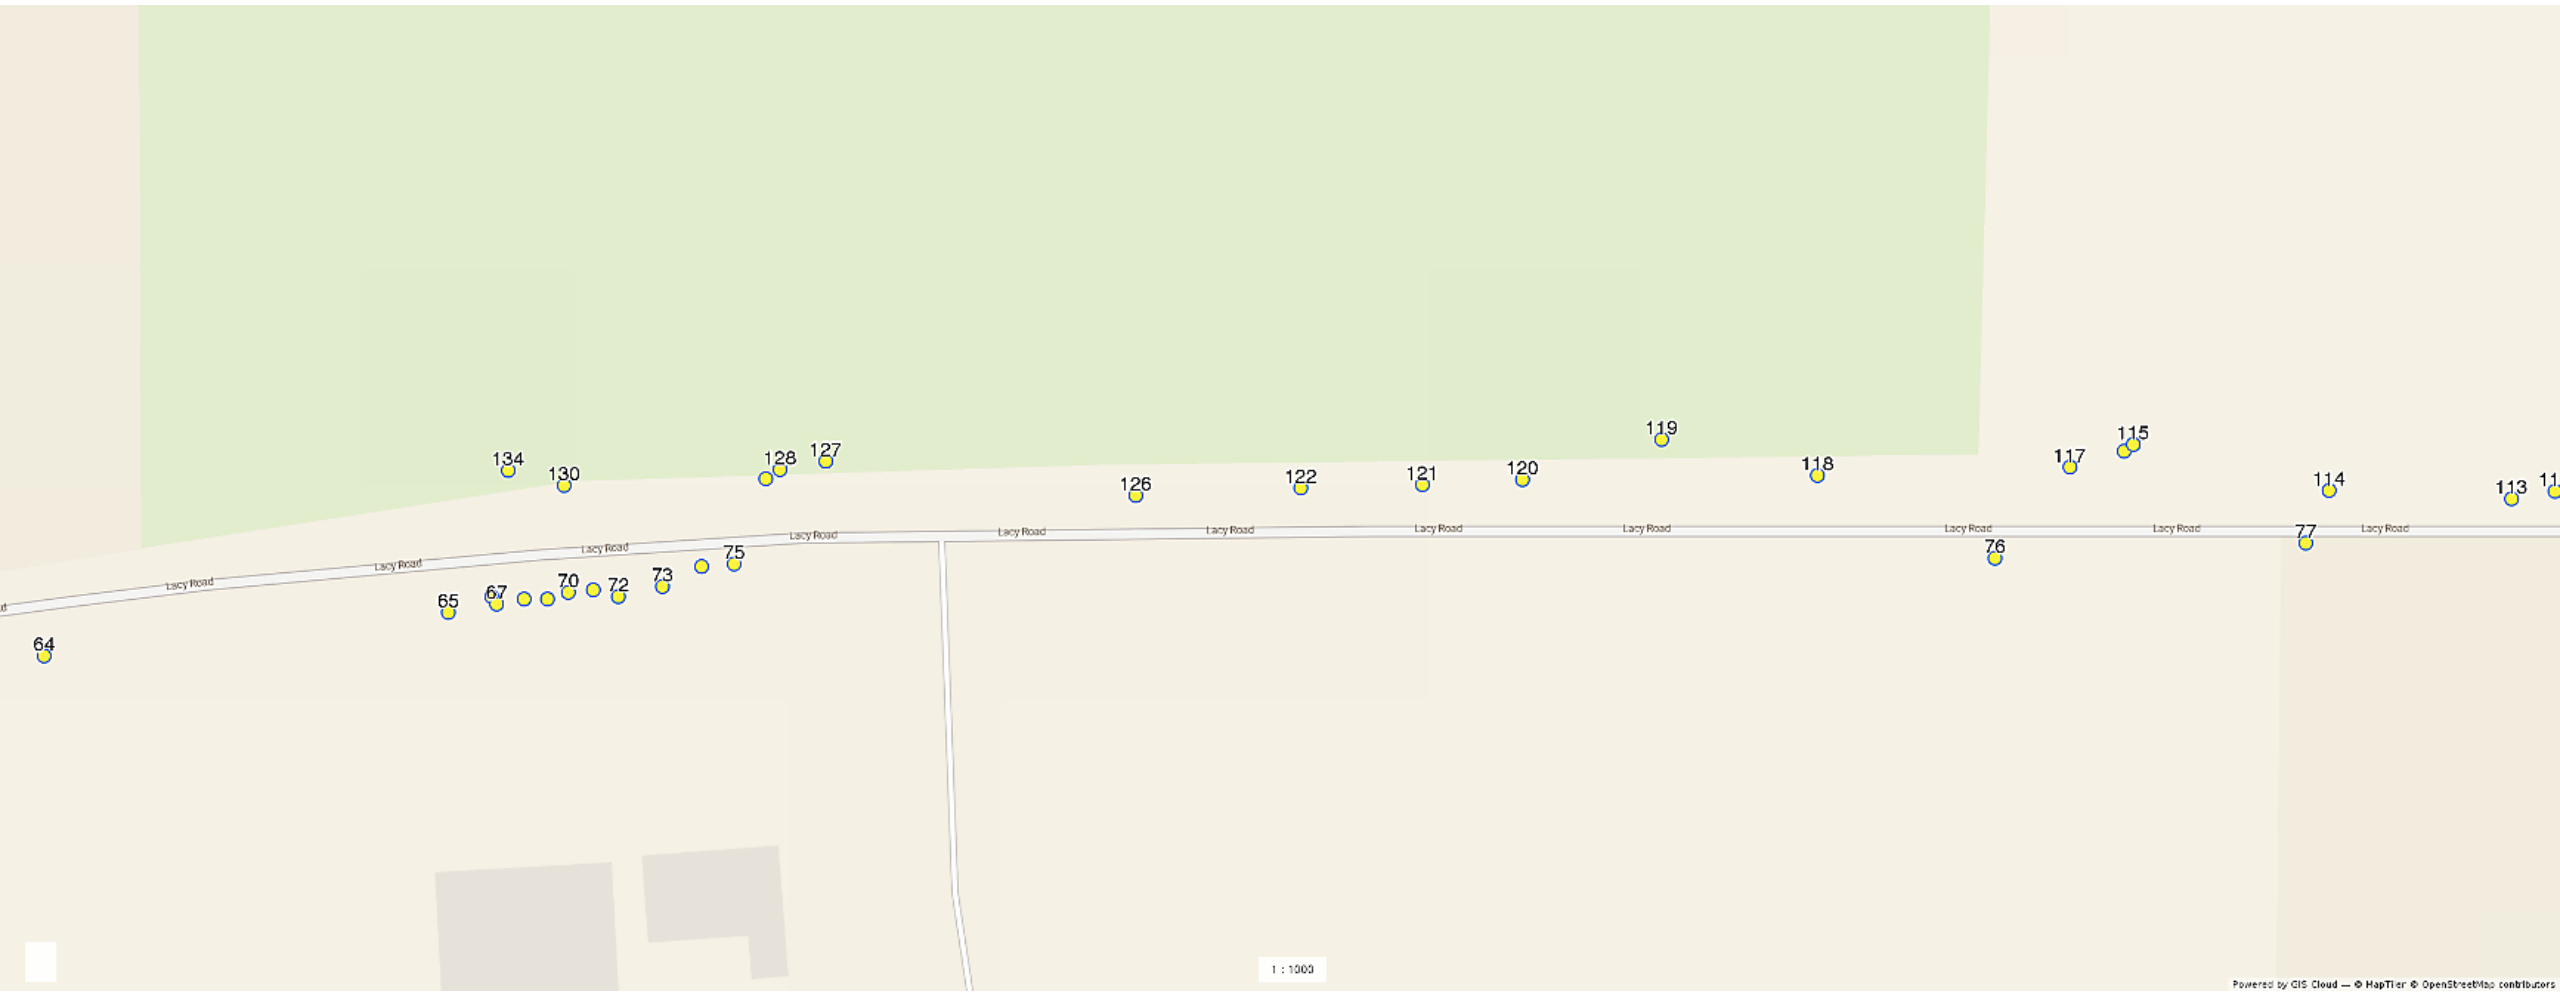

1 : 1000

Map 4 West to East




Map 5 West to East



1 : 1000

Map 6 West to East

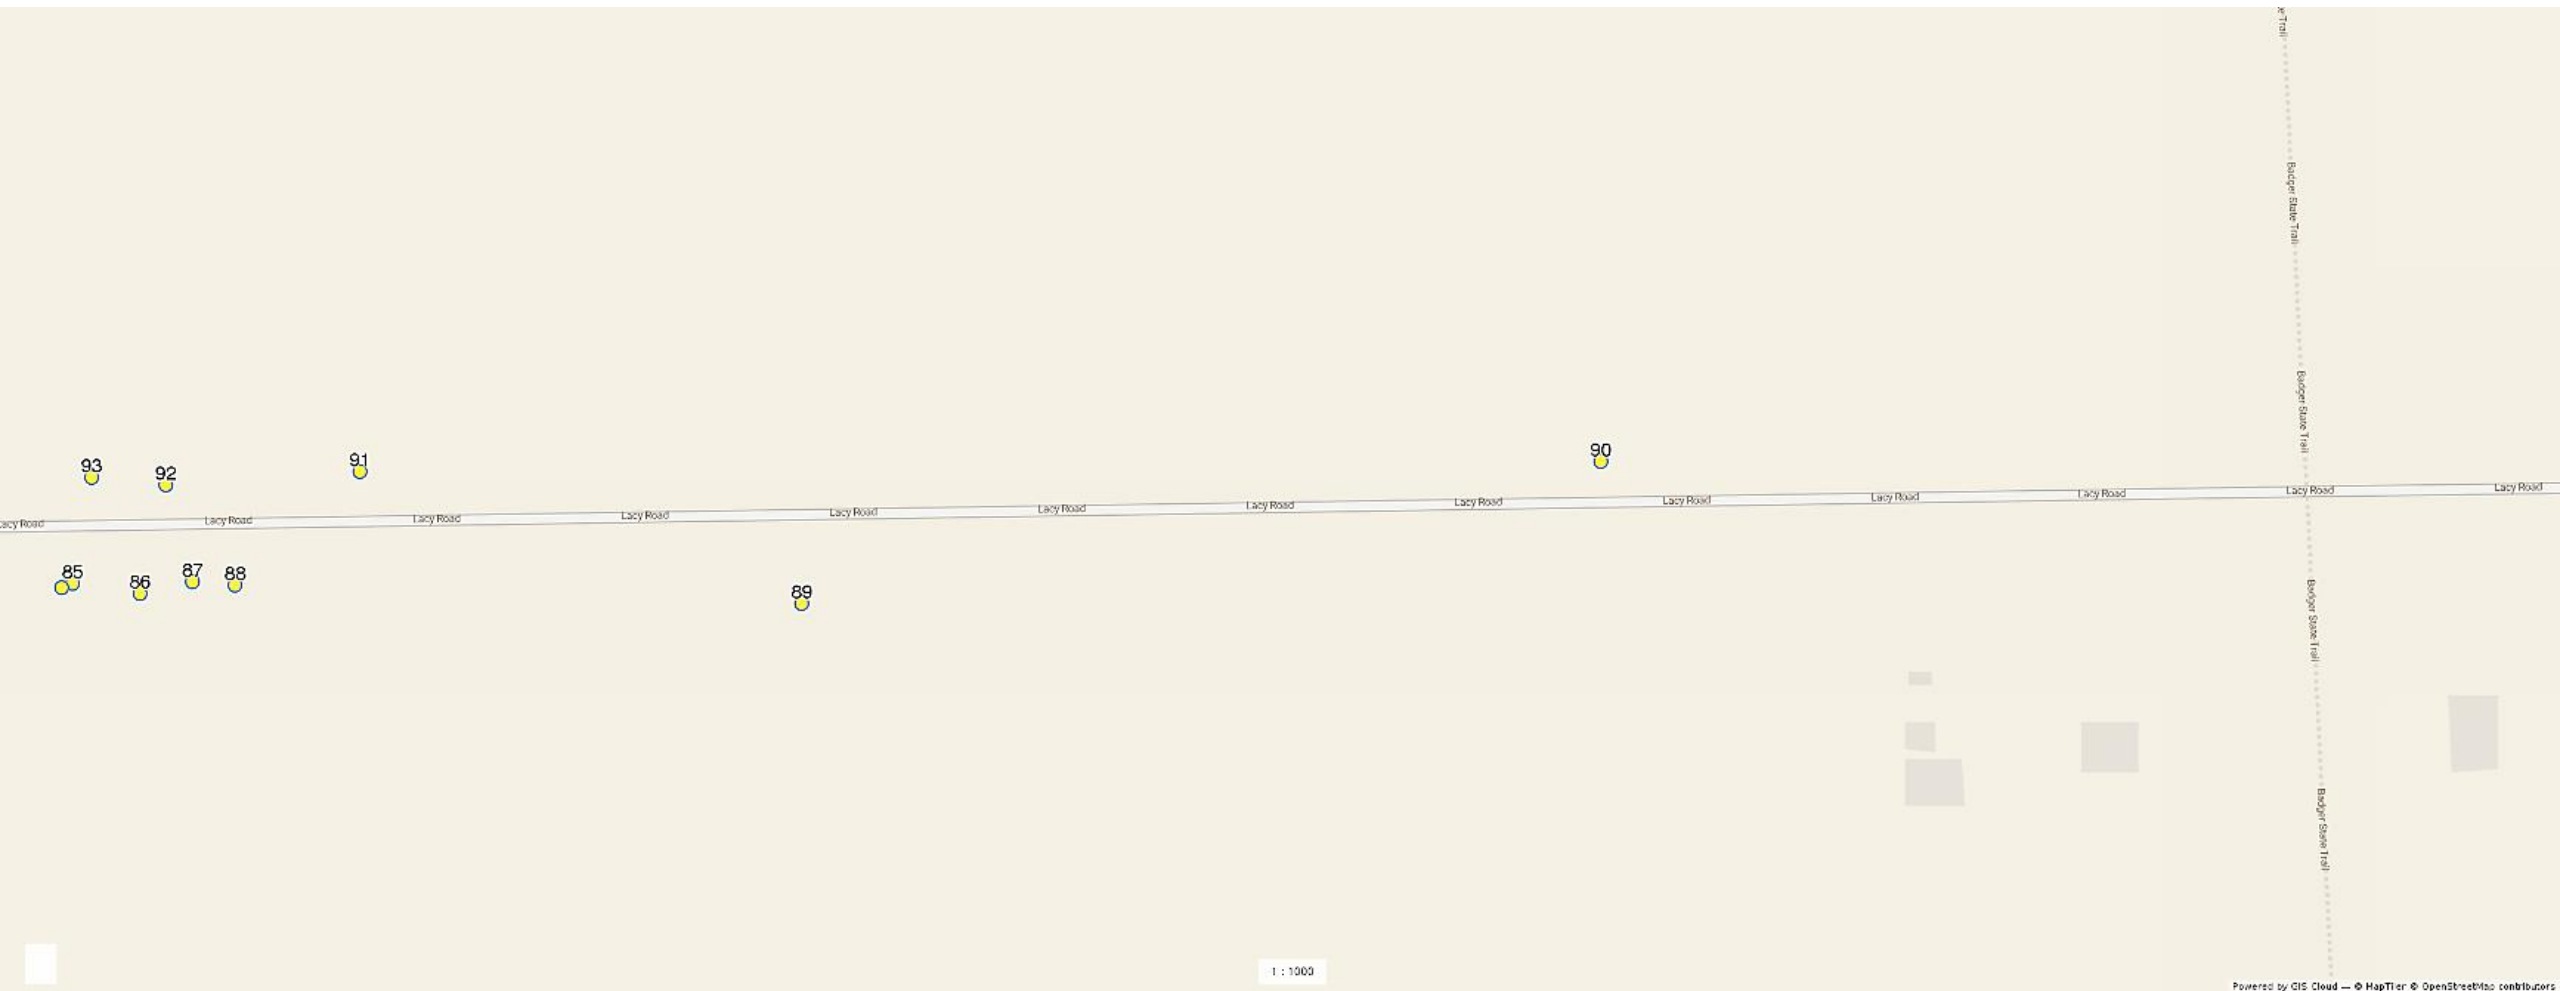

Lacy Road 2021 3/24/2021

#	ID	Tree
102	4	Begin South side of the street going east.. Cedar row. 20-30ft off road. Good condition
95	5	Beginning of honeysuckle, buckthorn, and prickly ash within 20-30ft of the road. This material continues for 1500ft to the east.
0	6	12inch walnut. Good condition. 40ft from road
1	7	13inch red oak. 13ft from road. Good condition. Pruned for power lines. North roots previously buried.
2	8	16inch Hackberry. Good condition 35ft from road.
3	9	10inch bur oak. 35 ft from road. Good to fair condition. Being crowded by bur oak.
4	10	22inch bur oak. 40ft from road. Good condition.
5	11	14inch bur oak. Good condition. 33ft from road.
6	12	10inch Hackberry. 35ft from road. Good to fair condition.
7	13	24inch bur oak. 25ft from road. Fair condition. Large deadwood. Some suckering. North roots have been buried slightly.
103	14	13inch Hackberry. 33ft from the road. Good condition.
8	15	Hackberry 13inch. Good condition. 25ft from road.
9	16	Hackberry 14inch. Good condition. 25ft from road.
10	17	Hackberry 13inch. 30ft from road. Good condition.
11	18	28inch red oak. Dead
12	19	17inch white oak. 20ft from road. Fair condition. North roots seem to be buried. 10inch stem removed and sealing at base.
13	46	2 stem bur oak. 20inch each. Good to fair condition. Pruned for powerlines. 16ft from road
14	47	12inch bur oak. Poor condition. 6ft trunk wound. Pruned for power lines. North roots buried.
15	48	33inch bur oak. 20ft off road. Good to fair condition. Pruned for power lines.
16	49	28inch bur oak. 22ft from road. North roots appear to be buried. Old basal wound sealing. Fair condition. Suckering and deadwood. Pruned for power lines
17	50	45inch red oak. Dead. 12ft from road.
18	51	Double leader white oak. 20inch each. Fair condition. Pruned for power lines. Lots of suckering. 12ft from road
104	52	22inch bur oak. Good to fair condition. 12ft from road. North roots slightly buried.
19	53	18inch red oak. Good to fair condition. 15ft from road. Open trunk wound at 7ft
20	54	16inch bur oak. Poor condition. Large deadwood. 6ft basal injury on South side. 2ft basal injury on north side. 16ft from road.
42	55	Still understory plants. Now includes sumac

#	ID	Tree
105	56	45inch bur oak. 11ft off road. Fair to poor condition. Large deadwood over road. Pruned for power lines. North roots buried. Large leader to west removed and almost fully sealed.
21	57	23inch bur oak. Fair condition. 12ft from road. North roots buried. Pruned for lines.
22	58	24inch red oak. 17ft from the road. Good to fair condition. Pruned for lines. Some suckering. Minimal deadwood.
23	59	8inch white spruce. 30ft from road. Fair to poor condition. Overcrowded by understood grasses and shrubs
24	60	10inch white spruce. 30ft from road. Fair condition.
25	61	8inch white spruce. 28ft from road. Good condition
26	62	3inch white fir. 28ft from road. Good to fair condition. Crowded by spruce
27	63	Several white pines. About 55ft approximately 35ft from the road. Good condition. Various diameters no larger than 10inches.
28	64	15inch white spruce. 20ft from road. Good condition.
29	65	15inch Blue spruce. 30ft from road. Good condition.
30	66	14inch white spruce. 30ft from road. Fair to good condition
31	67	10inch blue spruce. 30ft from road. Fair condition.
32	68	10inch blue spruce. 30ft from road. Fair to poor condition.
33	69	9inch white spruce. 30ft from road. Good to fair condition
34	70	11inch white spruce. 30ft from road. Good to fair condition.
106	71	9inch white spruce. 30ft from road. Poor condition. About 50% dead
35	72	9inch blue spruce. 30ft from road. Good to fair condition
107	73	11inch white spruce. 30ft from road. Good condition.
36	74	12inch Norway spruce. 30ft from road. Good condition
37	75	10inch Norway spruce. 30fr from road. Good to fair condition.
108	76	Begin honeysuckle and weed trees at 20ft from road
38	77	End of 130ft of woody veg at 20-30ft from road
39	78	Begin honeysuckle and buckthorn at 30-35ft from road
91	79	End of honeysuckle and buckthorn
92	80	Beginning of buckthorn and honeysuckle located within 30ft of the road
93	81	End of honeysuckle and buckthorn
40	82	30ft of honeysuckle at 30ft
41	83	20ft of honeysuckle at 30ft
43	84	23inch bur oak. 22ft from road. Fair to poor condition. Borer holes seen at the lower 6ft. Grape vines strangling lower limbs. Pruned for road and power line clearance
44	85	40inch bur oak. Poor condition. Most of tree torn out. Borer holes on lower 6ft. 20ft from road.

#	ID	Tree
45	86	25inch bur oak. Fair to poor condition. Pruned for power lines. Old basal wounds sealing well. Borer holes in the lower 6ft. Lots of suckering. Brown rot fungi present.
46	87	36inch bur oak. 25ft from road. Fair to poor condition. Borer holes at 8ft and up. Large deadwood. Pruned for lines and road clearance. Lots of suckering.
47	88	40inch bur oak. 20ft from road. Good to fair. Pruned for lines and road clearance. Minimal deadwood.
110	89	End of south side. 10ft of honeysuckle at 15ft in
109	90	Beginning of north side going from east to west. 20inch boxelder. 16ft from road. Good to fair condition.
48	91	11inch bur oak. 15ft from road. Good condition.
49	92	18inch bur oak. 22ft from road. Good to fair condition.
50	93	28inch bur oak. 26ft from the road. Good to fair condition.
51	94	25inch black cherry. 20ft from road. Fair to good condition. Poor basal pruning cuts on suckers. No sign of black knot
52	95	Bur oak. 23ft from road. Basal damage. Twig galls. Fair condition.
53	96	Begin woody vegetation 20-30ft from road. Mostly boxelder, honeysuckle, and other woody weeds. I will document valuable trees within 30ft of road.
54	97	8inch Hackberry at 30ft. Good condition
55	98	6inch Hackberry at 30ft. Good condition
56	99	10inch Hackberry at 15ft. Good to fair condition
57	100	24inch cottonwood at 30ft. Poor condition. 20ft trunk wound.
99	101	20inch cottonwood. At 30ft. Fair to good. Some larger deadwood
58	102	18inch cottonwood. Fair to good. At 30ft.
59	103	18inch cottonwood at 35ft. Fair to good
60	104	22inch cottonwood at 30ft. Fair. Large basal wound
111	105	30inch red oak. Fair condition. Large deadwood. 30ft from the road.
61	106	18inch black locust. 20ft. Fair. 1/2 torn out
62	107	10inch black locust. 20ft good condition.
63	108	2 stem black locust. 16inch each. Dead
		Begin black locust Grove. All trees within 20ft of road are in fair to poor condition.
94	109	Large deadwood and trunk cavities. Large areas of fungal bodies present indicating decay.
64	110	End of black locust
65	111	20ft. 25inch Hackberry. Good condition. Has a pink dot
66	112	25inch white oak. 20ft from road. Good to fair condition. Pink dot
67	113	10inch Hackberry. 20ft from road. Good condition
68	114	Begin black locusts again.
98	115	2, 10inch boxelder. 15ft from road. Good to fair condition.

#	ID	Tree
69	116	End black locusts
70	117	12inch boxelder. 15ft from road. Fair condition.
97	118	16inch boxelder. 15ft from road. Fair condition.
101	119	17inch boxelder. 20ft from road. Fair condition
100	120	Begin underbrush at 20-30ft from the road
71	121	10inch white walnut at 30ft in. Good condition
72	122	32inch red oak. 20ft from road. Fair condition. Lots of large deadwood
73	123	12inch Hackberry at 20ft. Good condition. Uphill
74	124	12inch Hackberry at 20ft. Good condition. Uphill
75	126	12inch Hackberry at 20ft. Good condition. Uphill
76	127	14inch shagbark hickory. 15ft from road. Good condition.
77	128	18inch Cherry. 30ft. Dead
78	129	10inch bur oak. 30ft in. Good condition
96	130	10inch Hackberry. 15ft from road. Good condition
79	131	6inch white walnut. 30ft in. Good condition.
80	132	3 stem red oak. 20inches each. Poor condition. At 30ft
81	133	10inch Hackberry. At 20ft. Good condition. Uphill
82	134	End of wood vegetation
83	136	14inch bur oak at 30ft uphill. Good to fair condition
84	137	Multistem Hackberry at 30ft from road. Good condition. Wires run through it.
88	138	10iinch Hackberry. 20ft from road. Good condition.
85	139	16inch Hackberry. 25ft from road. Good condition.
86	140	11inch Hackberry. 30ft uphill. Good condition
89	141	5inch shagbark hickory. 15ft from road. Uphill. Good condition
90	142	Multistem juniper. 6ft wide. Fair condition. 17ft from road.
87	143	End of woody underbrush